


Agilent 34401A Multimeter

Uncompromising Performance for Benchtop and System Testing

Product Overview

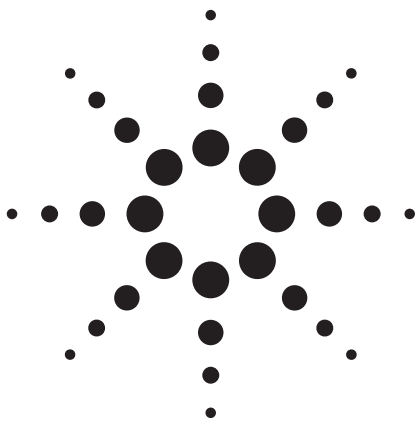

- Measure up to 1000 volts with 6½ digits resolution
- 0.0015% basic dcV accuracy (24 hour)
- 0.06% basic acV accuracy (1 year)
- 3Hz to 300kHz ac bandwidth
- 1000 readings/sec. direct to GPIB

Superior performance

The Agilent Technologies 34401A multimeter gives you the performance you need for fast, accurate bench and system testing. The 34401A provides a combination of resolution, accuracy and speed that rivals DMMs costing many times more. 6½-digits of resolution, 0.0015% basic 24-hr dcV accuracy and 1,000 readings/sec direct to GPIB assure you of results that are accurate, fast, and repeatable.

Use it on your benchtop

The 34401A was designed with your bench needs in mind. Functions commonly associated with bench operation, like continuity and diode test, are built in. A Null feature allows you to remove lead resistance and other fixed offsets in your measurements.

Other capabilities like min/max/avg readouts and direct dB and dBm measurements make checkout with the 34401A faster and easier.

The 34401A gives you the ability to store up to 512 readings in internal memory. For trouble-shooting, a reading hold feature lets you concentrate on placing your test leads without having to constantly glance at the display.

Use it for systems testing

For systems use, the 34401A gives you faster bus throughput than any other DMM in its class. The 34401A can send up to 1,000 readings/sec directly across GPIB in user-friendly ASCII format.

You also get both GPIB and RS-232 interfaces as standard features. Voltmeter Complete and External Trigger signals are provided so you can synchronize to other instruments in your test system. In addition, a TTL output indicates Pass/Fail results when limit testing is used.

To ensure both forward and backward compatibility, the 34401A includes three command languages (SCPI, Agilent 3478A and Fluke 8840A /42A), so you don't have to rewrite your existing test software. An optional rack mount kit is available.

Easy to use

Commonly accessed attributes, such as functions, ranges, and resolution are selected with a single button press.

Advanced features are available using menu functions that let you optimize the 34401A for your applications.

The included Agilent IntuiLink software allows you to put your captured data to work easily, using PC applications such as Microsoft Excel® or Word® to analyze, interpret, display, print, and document the data you get from the 34401A. You can specify the meter setup and take a single reading or log data to the Excel spreadsheet in specified time intervals. Programmers can use ActiveX components to control the DMM using SCPI commands. To find out more about IntuiLink, visit www.agilent.com/find/intuilink

1-year Warranty


With your 34401A, you get full documentation, a high-quality test lead set, calibration certificate with test data, and a 1-year warranty, all for one low price.



Agilent Technologies

Accuracy Specifications ± (% of reading + % of range) ^[1]

Function	Range ^[3]	Frequency, etc.	24 Hour ^[2] 23°C ± 1°C	90 Day 23°C ± 5°C	1 Year 23°C ± 5°C	Temperature Coefficient 0°C – 18°C 28°C – 55°C
dc Voltage	100.0000 mV		0.0030 + 0.0030	0.0040 + 0.0035	0.0050 + 0.0035	0.0005 + 0.0005
	1.000000 V		0.0020 + 0.0006	0.0030 + 0.0007	0.0040 + 0.0007	0.0005 + 0.0001
	10.00000 V		0.0015 + 0.0004	0.0020 + 0.0005	0.0035 + 0.0005	0.0005 + 0.0001
	100.0000 V		0.0020 + 0.0006	0.0035 + 0.0006	0.0045 + 0.0006	0.0005 + 0.0001
1000.000 V		0.0020 + 0.0006	0.0035 + 0.0010	0.0045 + 0.0010	0.0005 + 0.0001	
True rms ac Voltage^[4]	100.0000 mV	3 Hz - 5 Hz	1.00 + 0.03	1.00 + 0.04	1.00 + 0.04	0.100 + 0.004
		5 Hz - 10 Hz	0.35 + 0.03	0.35 + 0.04	0.35 + 0.04	0.035 + 0.004
		10 Hz - 20 kHz	0.04 + 0.03	0.05 + 0.04	0.06 + 0.04	0.005 + 0.004
		20 kHz - 50 kHz	0.10 + 0.05	0.11 + 0.05	0.12 + 0.04	0.011 + 0.005
		50 kHz - 100 kHz	0.55 + 0.08	0.60 + 0.08	0.60 + 0.08	0.060 + 0.008
	100 kHz - 300 kHz ^[6]	4.00 + 0.50	4.00 + 0.50	4.00 + 0.50	0.20 + 0.02	
	1.000000 V to 750.000 V	3 Hz - 5 Hz	1.00 + 0.02	1.00 + 0.03	1.00 + 0.03	0.100 + 0.003
		5 Hz - 10 Hz	0.35 + 0.02	0.35 + 0.03	0.35 + 0.03	0.035 + 0.003
10 Hz - 20 kHz		0.04 + 0.02	0.05 + 0.03	0.06 + 0.03	0.005 + 0.003	
20 kHz - 50 kHz	0.10 + 0.04	0.11 + 0.05	0.12 + 0.04	0.011 + 0.005		
50 kHz - 100 kHz ^[5]	0.55 + 0.08	0.60 + 0.08	0.60 + 0.08	0.060 + 0.008		
100 kHz - 300 kHz ^[6]	4.00 + 0.50	4.00 + 0.50	4.00 + 0.50	0.20 + 0.02		
Resistance^[7]	100.0000 Ω	1 mA Current Source	0.0030 + 0.0030	0.008 + 0.004	0.010 + 0.004	0.0006 + 0.0005
	1.000000 kΩ	1 mA	0.0020 + 0.0005	0.008 + 0.001	0.010 + 0.001	0.0006 + 0.0001
	10.00000 kΩ	100 μA	0.0020 + 0.0005	0.008 + 0.001	0.010 + 0.001	0.0006 + 0.0001
	100.0000 kΩ	10 μA	0.0020 + 0.0005	0.008 + 0.001	0.010 + 0.001	0.0006 + 0.0001
	1.000000 MΩ	5.0 μA	0.002 + 0.001	0.008 + 0.001	0.010 + 0.001	0.0010 + 0.0002
	10.00000 MΩ	500 nA	0.015 + 0.001	0.020 + 0.001	0.040 + 0.001	0.0030 + 0.0004
	100.0000 MΩ	500 nA 10MΩ	0.300 + 0.010	0.800 + 0.010	0.800 + 0.010	0.1500 + 0.0002
dc Current	10.00000 mA	<0.1 V Burden Voltage	0.005 + 0.010	0.030 + 0.020	0.050 + 0.020	0.002 + 0.0020
	100.0000 mA	<0.6 V	0.010 + 0.004	0.030 + 0.005	0.050 + 0.005	0.002 + 0.0005
	1.000000 A	<1 V	0.050 + 0.006	0.080 + 0.010	0.100 + 0.010	0.005 + 0.0010
	3.00000 A	<2 V	0.100 + 0.020	0.120 + 0.020	0.120 + 0.020	0.005 + 0.0020
True rms ac Current^[4]	1.000000 A	3 Hz - 5 Hz	1.00 + 0.04	1.00 + 0.04	1.00 + 0.04	0.100 + 0.006
		5 Hz - 10 Hz	0.30 + 0.04	0.30 + 0.04	0.30 + 0.04	0.035 + 0.006
		10 Hz - 5 kHz	0.10 + 0.04	0.10 + 0.04	0.10 + 0.04	0.015 + 0.006
	3.00000 A	3 Hz - 5 Hz	1.10 + 0.06	1.10 + 0.06	1.10 + 0.06	0.100 + 0.006
		5 Hz - 10 Hz	0.35 + 0.06	0.35 + 0.06	0.35 + 0.06	0.035 + 0.006
		10 Hz - 5 kHz	0.15 + 0.06	0.15 + 0.06	0.15 + 0.06	0.015 + 0.006
Frequency or Period^[8]	100 mV to 750 V	3 Hz - 5 Hz	0.10	0.10	0.10	0.005
		5 Hz - 10 Hz	0.05	0.05	0.05	0.005
		10 Hz - 40 Hz	0.03	0.03	0.03	0.001
		40 Hz - 300 kHz	0.006	0.01	0.01	0.001
Continuity	1000.0Ω	1mA Test Current	0.002 + 0.010	0.008 + 0.020	0.010 + 0.020	0.001 + 0.002
Diode Test^[9]	1.0000V	1mA Test Current	0.002 + 0.010	0.008 + 0.020	0.010 + 0.020	0.001 + 0.002

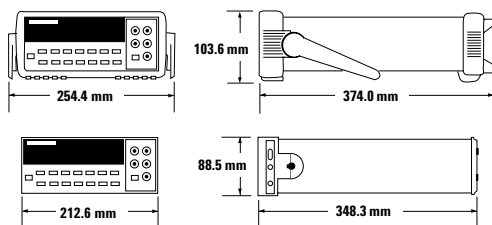

[1] Specifications are for 1hr warm-up and 6½ digits. Slow ac filter.

[2] Relative to calibration standards.

[3] 20% over range on all ranges except 1000 Vdc and 750 Vac ranges.

[4] For sinewave input > 5% of range. For inputs from 1% to 5% of range and < 50 kHz, add 0.1% of range additional error.

[5] 750 V range limited to 100 kHz or 8 x107 Volt-Hz.

[6] Typically 30% of reading error at 1 MHz.

[7] Specifications are for 4-wire ohms function or 2-wire ohms using Math Null.

Without Math Null, add 0.2 Ω additional error in 2-wire ohms function.

[8] Input >100 mV. For 10 mV to 100 mV inputs multiply % of reading error x10.

[9] Accuracy specifications are for the voltage measured at the input terminals only.

1 mA test current is typical. Variation in the current source will create some variation in the voltage drop across a diode junction.

Measurement Characteristics

dc Voltage

Measurement Method:
Continuously Integrating Multi-slope III
A-D Converter

A-D Linearity:
0.0002% of reading + 0.0001% of range

Input Resistance:
10 M Ω or 0.1V, 1V, 10 V ranges:
Selectable >10,000 M Ω

100 V, 1000 V ranges:
10 M Ω \pm 1%

Input Bias Current:
< 30pA at 25 $^{\circ}$ C

Input Protection:
1000 V all ranges

dcV:dcV Ratio Accuracy:
 V_{input} Accuracy + $V_{reference}$ Accuracy

True rms ac Voltage

Measurement Method:
ac coupled True rms – measures the ac
component of the input with up to 400 Vdc
of bias on any range

Crest Factor:
Maximum of 5:1 at Full Scale

Additional Crest Factor Errors (non-sinewave):
Crest Factor 1–2: 0.05 % of reading
Crest Factor 2–3: 0.15 % of reading
Crest Factor 3–4: 0.30 % of reading
Crest Factor 4–5: 0.40 % of reading

Input Impedance:
1 M Ω \pm 2% in parallel with 100 pF

Input Protection:
750 Vrms all ranges

Resistance

Measurement Method:
Selectable 4-wire or 2-wire Ohms.
Current source referenced to LO input.

Maximum Lead Resistance (4-wire):
10% of range per lead for 100 Ω and 1k Ω
ranges. 1k Ω per lead on all other ranges.

Input Protection:
1000 V all ranges

dc Current

Shunt Resistance:
5 Ω for 10 mA, 100 mA; 0.1 Ω for 1 A, 3 A

Input Protection:
Externally accessible 3 A 250 V Fuse
Internal 7 A 250 V Fuse

True rms ac Current

Measurement Method:
Direct coupled to the fuse and shunt.
ac coupled True rms measurement
(measures the ac component only).

Shunt Resistance:
0.1 Ω for 1 A and 3 A ranges

Input Protection:
Externally accessible 3 A 250 V Fuse
Internal 7 A 250 V Fuse

Frequency and Period

Measurement Method:
Reciprocal counting technique

Voltage Ranges:
Same as ac Voltage Function

Gate Time:
1 s, 100 ms, or 10 ms.

Continuity / Diode

Response Time:
300 samples/s with audible tone

Continuity Threshold:
Selectable from 1 Ω to 1000 Ω

Measurement Noise Rejection 60 (50) Hz ⁽¹⁾

dc CMRR: 140 dB

ac CMRR: 70 dB

Integration Time and Normal Mode Rejection ⁽²⁾

100 plc / 1.67 s (2 s): 60 dB ⁽³⁾

10 plc / 167 ms (200 ms): 60 dB ⁽³⁾

1 plc / 16.7 ms (20 ms): 60 dB

<1 plc / 3 ms or 800 μ s: 0 dB

Operating Characteristics ⁽⁴⁾

Function	Digits	Readings/s
dcV, dcl, and Resistance	6½	0.6 (0.5)
	6½	6 (5)
	5½	60 (50)
	5½	300
	4½	1000
acV, acI	6½	0.15 Slow (3Hz)
	6½	1Medium (20Hz)
	6½	10 Fast (200Hz)
	6½	50 ⁽⁵⁾
Frequency or Period	6½	1
	5½	9.8
	4½	80

System Speeds ⁽⁶⁾

Configuration Rates: 26/s to 50/s

Autorange Rate (dc Volts): > 30/s

ASCII readings to RS-232: 55/s

ASCII readings to GPIB: 1000/s

Maximum Internal Trig. Rate: 1000/s

Max. Ext. Trig. Rate to Memory: 1000/s

Triggering and Memory

Reading HOLD Sensitivity:
10%, 1%, 0.1%, or 0.01% of range

Samples/ trigger:
1 to 50,000

Trigger Delay:
0 to 3600 s: 10 μ s step size

External Trigger Delay:
< 1 ms

External Trigger Jitter:
< 500 μ s

Memory:
512 readings

Math Functions

NULL, Min/Max/Average, dBm, dB,
Limit Test (with TTL output)

Standard Programming Languages

SCPI (IEEE-488.2), Agilent 3478A,
Fluke 8840A/42A

Accessories Included

Test Lead Kit with probe, alligator,
and grabber attachments.

Operating Manual, Service Manual, test report,
and power cord.

General Specifications

Power Supply:
100 V/120 V/220 V/240 V \pm 10%

Power Line Frequency:
45 Hz to 66 Hz and 360 Hz to 440 Hz
Automatically sensed at power-on

Power Consumption:
25 VA peak (10 W average)

Operating Environment:
Full accuracy for 0 $^{\circ}$ C to 55 $^{\circ}$ C
Full accuracy to 80% R.H. at 40 $^{\circ}$ C

Storage Environment:
– 40 $^{\circ}$ C to 70 $^{\circ}$ C

Weight:
3.6 kg (8.0 lbs)

Safety:
Designed to CSA, UL-1244, IEC-348

RFI and ESD:
MIL-461C, FTZ 1046, FCC

Vibration and Shock:
MIL-T-28800E, Type III, Class 5 (Sine Only)

Warranty:
1 year

[1] For 1k Ω unbalance in LO lead.

[2] For power line frequency \pm 0.1%.

[3] For power line frequency \pm 1% use 40dB or
 \pm 3% use 30dB.

[4] Reading speeds for 60Hz and (50Hz) operation.

[5] Maximum useful limit with default settling
delays defeated.

[6] Speeds are for 4½ digits, Delay 0, Auto-zero
and Display OFF.

Ordering Information

Agilent 34401A Multimeter Accessories included

Test Lead Kit with probe, alligator, and grabber attachments, operating manual, service manual, calibration certificate, test report, and power cord.

Options

34401A-1CM

Rack Mount Kit* (P/N 5062-3972)

34401A-OB0

DMM without manuals

34401A-A6J

ANSI Z540 compliant calibration

Manual options (please specify one)

34401A-ABA	US English
34401A-ABD	German
34401A-ABE	Spanish
34401A-ABF	French
34401A-ABJ	Japanese
34401A-ABZ	Italian
34401A-AB0	Taiwan Chinese
34401A-AB1	Korean
34401A-AB2	Chinese
34401A-AKT	Russian

Agilent Accessories

11059A Kelvin Probe set

11060A Surface Mount Device (SMD)
test probes

11062A Kelvin clip set

34131 Hard transit case

34161A Accessory pouch

34171A Input terminal connector
(sold in pairs)

34172A Input calibration short
(sold in pairs)

34330A 30 A current shunt

E2308A 5K thermistor probe

*For racking two side-by-side,
order both items below:
Lock link kit (P/N 5061-9694)
Flange kit (P/N 5063-9212)

Microsoft is a U.S. registered trademark
of Microsoft Corporation.



Agilent Email Updates

www.agilent.com/find/emailupdates

Get the latest information on the products and applications you select.

Agilent T&M Software and Connectivity

Agilent's Test and Measurement software and connectivity products, solutions and developer network allows you to take time out of connecting your instruments to your computer with tools based on PC standards, so you can focus on your tasks, not on your connections.

Visit www.agilent.com/find/connectivity
for more information.

Agilent Technologies' Test and Measurement Support, Services, and Assistance

Agilent Technologies aims to maximize the value you receive, while minimizing your risk and problems. We strive to ensure that you get the test and measurement capabilities you paid for and obtain the support you need. Our extensive support resources and services can help you choose the right Agilent products for your applications and apply them successfully. Every instrument and system we sell has a global warranty. Two concepts underlie Agilent's overall support policy: "Our Promise" and "Your Advantage."

Our Promise

Our Promise means your Agilent test and measurement equipment will meet its advertised performance and functionality. When you are choosing new equipment, we will help you with product information, including realistic performance specifications and practical recommendations from experienced test engineers. When you receive your new Agilent equipment, we can help verify that it works properly, and help with initial product operation.

Your Advantage

Your Advantage means that Agilent offers a wide range of additional expert test and measurement services, which you can purchase according to your unique technical and business needs. Solve problems efficiently and gain a competitive edge by contracting with us for calibration, extra-cost upgrades, out-of-warranty repairs, and onsite education and training, as well as design, system integration, project management, and other professional engineering services. Experienced Agilent engineers and technicians worldwide can help you maximize your productivity, optimize the return on investment of your Agilent instruments and systems, and obtain dependable measurement accuracy for the life of those products.

Get assistance with all your test and measurement needs at:

www.agilent.com/find/assist

Agilent's IO Libraries Suite ships with the 34401A to help you quickly establish an error-free connection between your PC and instruments—regardless of the vendor. It provides robust instrument control and works with the software development environment you choose.

For additional description of Agilent's IO Libraries Suite features and installation requirements, please go to:

www.agilent.com/find/iosuite-datasheet

Product specifications and descriptions in this document subject to change without notice.

© Agilent Technologies, Inc. 1998, 2000, 2005
Printed in the U.S.A. May 1, 2005
5968-0162EN



Agilent Technologies